

SB 630797



Reference: Date: WT02-001 NTB02-030 March 15, 2002

2002 ALTIMA WHEEL COVER SQUEAK/CLICK NOISE

APPLIED VEHICLES: 2002 Altima (L31)

SERVICE INFORMATION

If the wheel cover(s) of a 2002 Altima makes a squeak or click noise once per wheel revolution, the cause may be:

Contact between the clip portion of the factory wheel weight and the outer edge of the cover.

NOTES:

- "Witness" (contact or scrape) marks may be present on the wheel weight clips (See Figure 1) and inside edge of the wheel covers of affected vehicles.
- Replacing the wheel covers will not resolve this issue.

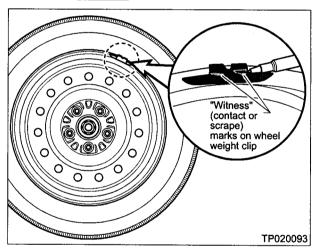


Figure 1

Use the Service Procedure provided in this bulletin to repair this incident, if it should occur.

SERVICE PROCEDURE

- 1. Remove the affected wheel cover(s).
- 2. Clean the entire surface of the wheel weight (and its clip) with Genuine Nissan Brake Cleaner. Allow the weight and clip to dry completely.
- 3. Attach a strip of Felt Cloth Tape to the factory wheel weight (as shown in Figure 2, below).
- 4. Wrap the ends of the tape around the outer edge of the clip (see Figure 2).

NOTES:

- If the wheel cover is removed in future, the condition of the tape should be checked and it should be replaced, if necessary.
- If the wheel is re-balanced, new tape must be applied.

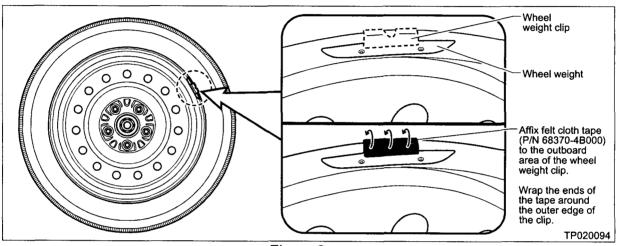


Figure 2

- 5. Repeat steps 2 through 4 for all affected wheels.
- 6. Re-install all wheel covers.
- 7. Test drive the vehicle to verify squeaking/clicking is no longer present.

PARTS INFORMATION

DESCRIPTION	PART NUMBER	QUANTITY
Felt Cloth Tape (1 each per package)	68370-4B000	1 each per affected wheel

CLAIMS INFORMATION

Submit a Primary Failed Part (PP) line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
R&R All Wheel Covers	(1)	PW18AA	ZL	45	(2)

- (1) Reference the Altima Parts Catalog and use the indicated wheel cover P/N as the PFP.
- (2) Reference the current Nissan Warranty Flat Rate Manual and use the indicated FRT